

Case 324 : Narrative

Case Vehicle (A): 2000 Dodge
Type: Stratus SE, 4-door sedan
Driver: 20-year-old female
CDC: 12-FDEW-5

SITUATION

[1](#) [2](#) On a cloudy night, case vehicle (A) was traveling west, at an unknown speed on a two-lane asphalt road, in a rural area. The roads were dry, it was dark and unlighted, and the speed limit was 55 mph (89 kph). [3](#) [4](#) The driver may have fallen asleep and the vehicle crossed the centerline and eastbound lane, and exited the south edge of the road. [5](#) [6](#) [7](#) [8](#) The vehicle continued to travel west over a grassy area for approximately 63 meters before the front of the vehicle struck a 125-cm diameter tree that was located 5 meters south of the road edge. The vehicle was towed from the scene due to damage. The police reported "A" injuries for the driver, who was transported to a trauma center by helicopter.

GENERAL VEHICLE DAMAGE AND ESTIMATED CRASH SEVERITIES

[9](#) [10](#) The direct damage to the front of case vehicle (A) from impact with the tree was primarily to the left and center portions of the front bumper. The damage began at the left-front bumper corner and extended 105 cm to the right, resulting in 66-percent vehicle overlap. The maximum rearward crush was 91 cm to the center of the front bumper. Using the WinSMASH crash-reconstruction program and c-values measured for [11](#) [12](#) [13](#) [14](#) [15](#) [16](#) case vehicle (A), the following impact severity was calculated for the frontal impact with the tree.

		Calculated Velocity Change - kph (mph)		
Vehicle	Variable	Total	Longitudinal	Latitudinal
Case Vehicle (A) front	delta V	60 (37)	-60 (-37)	0 (0)

DESCRIPTION OF DAMAGE TO CASE VEHICLE (A)

Exterior

[17](#) [18](#) The entire front bumper was crushed rearward into the engine compartment, [19](#) the grille was damaged, and both headlight assemblies were broken. [20](#) [21](#) [22](#) The hood was crushed and pushed up and to the rear, the hood latch was damaged and jammed, both hood hinges were deformed but not separated, and the rear edge of the hood was elevated. [23](#) [24](#) Damage to the windshield from the crash is unknown due to the fact that the windshield was cut during extrication procedures.

[25](#) [26](#) On the left side, the fender was crumpled rearward into the left-front wheel well. [27](#) The left-front wheel was damaged, the hubcap came off of the wheel, and the left wheelbase was reduced 32 cm. [28](#) [29](#) All of the upper pillars were cut to remove the roof for extrication of the driver. [30](#) There was no damage to the left B- or C-pillars and the left-rear door was undamaged and operational. The upper and lower portions of the left A-pillar were deformed, causing the driver door to be jammed closed, and [31](#) the left portion of the roof was buckled just above the driver door. There was extrication damage to the door latch and B-pillar. The driver door was buckled, the door window frame was bent, and the door glazing was broken. [32](#) There was also no damage to the left-rear quarter panel.

[33](#) [34](#) On the right side, the front fender was deformed and moved to the left. [35](#) The right-front wheel was slightly damaged and the right wheelbase was reduced 15 cm. [36](#) [37](#) The right-front door was deformed and jammed closed, and the lower portion of the A-pillar was deformed. There was no damage to the upper or lower portions of the right B- or C-pillars.

[38](#) [39](#) There was no right-side glazing damage and no damage to the right-rear door or rear quarter panel.

[40](#) [41](#) There was no damage to the rear of case vehicle (A), but the rescue crew broke out the rear window.

Interior

[42](#) This vehicle was equipped with steering-wheel and passenger frontal-impact airbags, which deployed during the frontal impact. [43](#) There were blood droplets on the rear, upper, and left portions of the airbag skin. [44](#) [45](#) [46](#) [47](#) There was also a black patch of melted airbag fabric and a large tear on the right-rear portion of the airbag. This tear is thought to have been caused by interaction of the airbag with the wiper control level on the right side of the steering column during rapid clockwise rotation of the steering wheel and airbag module at the time of airbag deployment, which was partially forward through the steering-wheel rim due to the relatively close proximity of the driver. [48](#) [49](#) During inspection, the steering wheel was rotated 180 degrees from the normal position, and the upper half of the steering-wheel rim, which was at the bottom, was deflected forward approximately 11 cm. The upper steering wheel spokes were also slightly deformed, and the top half of the airbag flap was displaced forward and stuck behind the upper portion of the steering-wheel rim. [50](#) In addition, the steering column was rotated up and to the left.

[51](#) [52](#) The left side of the roof and roof headliner, and the upper portion of the left A-pillar, were deformed and displaced up. [53](#) The upper and mid portions of the instrument panel and knee bolster were damaged and displaced rearward. [54](#) The ignition key and windshield wiper lever were pushed forward and the wiper control lever was broken. [55](#) The driver section of the toepan was displaced rearward and the brake pedal was bent. The driver's right shoe was wedged between the pedal and the displaced toepan, and [56](#) the driver's left shoe was wedged between the displaced toepan and the front of the seat. [57](#) [58](#) The plastic on driver-door armrest was cracked, and the door hardware and glass were broken. [59](#) The driver seat adjuster failed, allowing the seat to move and rotate forward during the crash.

[60](#) There was no damage to the center section of the roof or the windshield header. [61](#) The vertical console was displaced rearward and the seat center console seats was crushed due to movement of the driver seat. The center rearview mirror was not available during the vehicle inspection.

[62](#) In the right-front seating area, there was no damage to the roof, to the windshield header, or to the right A-pillar. [63](#) The glove compartment was damaged and the glove-box door would not close. [64](#) There was no damage to the passenger frontal-impact airbag. [65](#) [66](#) The instrument panel and toepan were displaced to the rear and the floor was displaced up.

[67](#) [68](#) In the rear-seating area, the trunk contents had moved forward during the crash, resulting in damage to, and forward displacement of, the rear-seat backrests.

[69](#) [70](#) [71](#) The following intrusions were noted and measured:

Location	Component	Distance (cm)	Direction
left front	toepan	49	to rear
	instrument panel	21	to rear
	steering column	15	to rear
right front	toepan	46	to rear
	instrument panel	18	to rear
	floor	12	up
second center	second seatback	25	forward

OCCUPANT KINEMATICS AND INJURIES

[72](#) The 5 ft, 6 in, 132 lb, 20-year-old female driver was wearing the available three-point belt, and the airbag deployed during the frontal impact with the tree. [73](#) The shoulder-belt anchor point on the B-pillar was adjusted to a high position. [74](#) [75](#) [76](#) [77](#) [78](#) Belt use at the

time of the crash is indicated by D-ring marks on the shoulder-belt webbing and the fact that the belt was locked in an extended position. [79](#) [80](#) The lower buckle assembly was attached to the seat track on the inboard side.

During the frontal impact, the female driver moved forward relative to the vehicle interior, into the belt restraints and the airbag. [82](#) [83](#) She sustained numerous head and face injuries, probably from contact with the steering-wheel rim through the airbag, due to the large airbag tear. These injuries include a right subarachnoid hemorrhage near the sylvian fissure, right frontal and temporal lobe intraparenchymal contusions, a left subcondylar mandibular fracture with anterior and medial displacement, a laceration to the lower lip, fractures to #12 and #13 teeth, and lacerations to the right aspect of the chin. She also sustained a laceration to the right posterior aspect of the scalp from an unknown source. She sustained a pulmonary contusion to the upper aspect of the right lobe of the lung, possibly from close-proximity chest loading by the airbag, from chest loading by the shoulder belt, or from chest contact with the steering wheel through the torn airbag. She sustained an abrasion and contusion to the lower-left aspect of the abdomen, probably from loading by the lap belt.

[84](#) She sustained a laceration to the dorsal aspect of the right hand, possibly from contact with the windshield wiper lever or ignition key, as evidenced by both being pushed forward into the instrument panel. [85](#) [86](#) She sustained an abrasion to the left knee, a contusion to the left shin, and a contusion to the medial aspect of the right knee, probably from contact by the knee bolster, as evidenced by scuff marks on the bolster. [87](#) [88](#) She also sustained severe injuries to the right foot from contact with the toepan. These injuries include dislocation to the subtalar joint, displaced and comminuted fractures to the talar head and neck, a fracture to the medial aspect of the cuneiform, a fracture of the third metatarsal, and medial subluxation of the right cuboid on the calcaneus. [89](#) [90](#) [91](#) There were scuff marks on the right portion of the knee bolster and the lower portion of the door panel, but no injuries were attributed to these contacts.

The following table and attached drawing [92](#) summarize the injuries for the restrained driver.

Occupant: Driver	Age: 20 years		Gender: Female	
Restraints: 3-point belt worn; airbag deployed	Stature: 170 cm (5 ft, 6 in)		Mass: 60 kg (132 lb)	
Injury Description	A.I.S.	Injury Source		
—	—	Definite	Probable	Possible
Laceration, right posterior aspect of scalp	1	—	—	Unknown
Right subarachnoid hemorrhage near the sylvian fissure	3	—	Steering-wheel rim through torn airbag	—
Right frontal and temporal lobe intraparenchymal contusion	3	—	Steering-wheel rim through torn airbag	—
Left subcondylar mandibular fracture, anterior and medial displacement	2	—	Steering-wheel rim through torn airbag	—
Laceration, lower lip	1	—	Steering-wheel rim through torn airbag	—
Teeth fractures, #12 and #13	1	—	Steering-wheel rim through torn airbag	—
Lacerations, right aspect of chin	1	—	Steering-wheel rim through torn airbag	—
Pulmonary contusion, right upper lobe	3	—	—	Airbag, steering-wheel rim through torn airbag, shoulder belt
Abrasion, left lower aspect of abdomen	1	—	Lap belt	—
Contusion, left lower aspect of abdomen	1	—	Lap belt	—
Laceration, dorsal aspect of right hand	1	—	—	Windshield-wiper lever, ignition key
Abrasion, left knee	1	—	Knee bolster	—
Contusion, left shin	1	—	Knee bolster	—
Contusion, medial aspect of right knee	1	—	Knee bolster	—
Dislocation, right subtalar joint	1	—	Toe pan	—

Medial subluxation of the right cuboid on the calcaneus	2	—	Toepan	—
Fracture, right cuboid extending into the base of the metatarsal	2	—	Toepan	—
Fracture, medial aspect of right cuneiform	2	—	Toepan	—
Fracture, right #3 metatarsal	2	—	Toepan	—
Maximum A.I.S. Level	3	—	—	—
Injury Severity Score	22	—	—	—

CASE NO. - 88402

CASE HISTORY: 2008 Dodge

TYPE: Domestic SE, 6 door sedan

EXCIDENT: January 20-year old female

STATURE: 168-cm 5' 6", 50 kg

 
HAIR: Brown (Dye)

FEET WARE: 2-point left shoe, nothing on right

SEVERITY:


GRADE - 3

ISS - 23



Case No. 204-03
Case No. (A): 2000 Bridge
Type: Slab-on-Beam, Urban center
Span: 20-met and 20-met

 Position: Chiefly
 Road Surface: Dry
 Road Construction: Asphalt
 Light Condition: Dark/Overcast



Vehicle Report

General

Conditions

Variable Number and Name	Code Value	Code Description	Other Options
V206 — Urban/Rural Area	2	Rural	more
V207 — Limited Access Highway	0	No	more
V208 — Road Total Lanes	2	2 lanes	more
V209 — Intersecting Road Total Lanes	8	Not applicable	more
V210 — Road Surface Type	1	Asphalt	more
V211 — Road Defects	0	No	more
V212 — Construction Zone	0	No	more
V213 — Road Alignment Vertical Plane	1	Level	more
V214 — Road Alignment Horizontal Plane	1	Straight	more
V215 — Surface Covering	10	Dry	more
V216 — Visibility Limitation	0	None	more
V217 — Visibility Obstruction	0	None	more
V218 — Speed Limit	6	86-90 km/h .. 55 mph	more
V219 — Precipitation Type	0	None	more
V220 — Precipitation Rate	8	Not applicable	more
V221 — Temperature	9	Unknown	more
V222 — Crosswind	9	Unknown	more
V223 — Light Conditions	5	Dark, unlighted	more
V224 — Mechanical Malfunction Mention	0	No	more
V225 — Case Vehicle and Object	1	Yes	more
V226 — Case Vehicle Rollover	0	No	more
V227 — Case Vehicle Ran Off Roadway	1	Yes	more
V228 — Moving Case Vehicle/Contacted	0	No	more

Moving Vehicle			
V229 — Case Vehicle/Contacted Stopped Vehicle	0	No	more
V230 — Stopped Case Vehicle/Contactd Vehicle	0	No	more
V231 — Total Vehicles Hit By Case Vehicle	0	0 vehicles	more
V232 — Any Fire in Crash	0	No	more
V233 — Max Police Severity-PAR	3	A - Incapacitating Injury	more
V234 — Driver Alcohol Involvement	0	Had not been drinking	more
V235 — Driver Alcohol BAC	80	Not tested	more
V236 — Driver Impairment Mention	0	No	more
V237 — Driven/Towed From Scene	2	Towed Due to Damage	more

Other Vehicle

Variable Number and Name	Code Value	Code Description	Other Options
V301 — Other Vehicle VIN			more
V303 — Other Vehicle Manufacturer	998	No Other Vehicle	more
V304 — Other Vehicle Body Code	98	No Other Vehicle	more
V305 — Other Vehicle Make/Model	0000	No other vehicle	more
V306 — Other Vehicle Model Year	9999	No other vehicle	more
V307 — Other Vehicle Mass	999998	No other vehicle	more
V308 — Other Vehicle Number	8	No other vehicle	more
V309 — Other Vehicle Number of Occupants	98	No other vehicle	more
V310 — Other Vehicle Traveling Speed	999	Unknown	more
V311 — Highest Police Injury Severity	8	Unoccupied Vehicle	more
V312 — Other Vehicle Type	98	No Other Vehicle	more
V313 — Other Vehicle Wheelbase (cm)	998	No other vehicle	more
V314 — Average Track Width	999	Unknown	more
V315 — Overall Length	999	Unknown	more
V316 — Overall Width (OAW)	999	Unknown	more
V317 — Front Overhang (FOH)	999	Unknown	more
V318 — Rear Overhang (ROH)	999	Unknown	more
V319 — Undeformed End Width (UEW)	999	Unknown	more
V320 — Engine Displacement	9.9 l	—	—
V321 — Engine: Number of Cylinders	99	Unknown	more
V322 — Direct Damage Length (DDL)	999	Unknown	more
V323 — Front-End Overlap % (FEO)	99	Missing or Not applicable	more
V324 — Vehicle Overlap % (VOL)	99	Missing or Not applicable	more

Case Vehicle

General

Variable Number and Name	Code Value	Code Description	Other Options
V401 — VIN	1B3EJ46X7YN3	—	—
V402 — Manufacturer/Body Code	13228	—	—
V403 — Vehicle Manufacturer	132	Dodge	more
V404 — Vehicle Body Code	28	—	—
V405 — Make/Model Code	0766	Stratus	more
V406 — Model Year	2000	—	—
V407 — Vehicle Mass	001385 kg	—	—
V408 — Odometer Reading	888888	—	—
V409 — Number of Occupants	01	—	—
V410 — Traveling Speed	999	Unknown	more
V411 — Body Type	14	4-door sedan	more
V412 — Stolen Vehicle	8	Not currently collected	more
V413 — Body Structure	2	Unitized	more
V414 — Transmission Type	1	Automatic	more
V415 — Transmission Lever Location	3	Column	more
V416 — Steering	1	Power	more
V417 — Brakes	1	Power	more
V418 — Brake Type	2	Disc - front wheels	more
V419 — Brake Anti-lock Device	2	Four-wheel	more
V420 — Air Conditioning in Vehicle	8	Not currently collected	more
V421 — Drive Type	2	Front wheel	more
V422 — Dual Rear Wheels	0	No	more
V423 — Original Restraint System Type	3	Airbag	more
V424 — Equipped With Roll Bar	0	No	more

V425 — Roof Type	1	Solid	more
V426 — Wheelbase	274 cm	—	—
V427 — Anti-lacerative Glass	0	None	more
V428 — Average Track Width	153 cm	—	—
V429 — Overall Length	473 cm	—	—
V430 — Overall Width (OAW)	182 cm	—	—
V431 — Front Overhang	094 cm	—	—
V432 — Rear Overhang	105 cm	—	—
V433 — Undeformed End Width (UEW)	150 cm	—	—
V434 — Engine Displacement	2.4 <i>l</i>	—	—
V435 — Engine: Number of Cylinders	04	—	—
V436 — Direct Damage Length (DDL)	105 cm	—	—
V437 — Front End Overlap % (FEO)	70	—	—
V438 — Vehicle Overlap % (VOL)	66	—	—

Case Vehicle

Damage

Description

Variable Number and Name	Code Value	Code Description	Other Options
V501 — Maximum Crush - Front	091 cm	—	—
V502 — Maximum Crush - Right Side	000 cm	No crush (or less than 1 cm.)	more
V503 — Maximum Crush - Rear	000 cm	No crush (or less than 1 cm.)	more
V504 — Maximum Crush - Left Side	000 cm	No crush (or less than 1 cm.)	more
V505 — Maximum Crush - Roof	000 cm	No crush (or less than 1 cm.)	more
V506 — Maximum Crush - Other	000 cm	No crush (or less than 1 cm.)	more
V507 — Are Events In Chronological Order	1	Yes	more
V508 — Event 1 Impact Location	4	Outside Roadside right-of-way	more
V509 — Event 1 Impact Configuration	17	FRONT of case veh - object	more
V510 — Event 1 Object/Vehicle Contacted	77	Sign post, utility pole, tree	more
V511 — Event 2 Impact Location	8	No 2nd event	more
V512 — Event 2 Impact Configuration	88	No 2nd event	more
V513 — Event 2 Object/Vehicle Contacted	00	No object/vehicle contacted	more
V514 — Event 3 Impact Location	8	No 3rd event	more
V515 — Event 3 Impact Configuration	88	No 3rd event	more
V516 — Event 3 Object/Vehicle Contacted	00	No object/vehicle contacted	more
V517 — Event 4 Impact Location	8	No 4th event	more
V518 — Event 4 Impact Configuration	88	No 4th event	more
V519 — Event 4 Object/Vehicle Contacted	00	No object/vehicle contacted	more
V520 — Event 5 Impact Location	8	No 5th event	more
V521 — Event 5 Impact Configuration	88	No 5th event	more
V522 — Event 5 Object/Vehicle Contacted	00	No object/vehicle contacted	more
V523 — Event 6 Impact Location	8	No 6th event	more

V524 — Event 6 Impact Configuration	88	No 6th event	more
V525 — Event 6 Object/Vehicle Contacted	00	No object/vehicle contacted	more
V526 — Event 7 Impact On Road	8	No 7th event	more
V527 — Event 7 Impact Configuration	88	No 7th event	more
V528 — Event 7 Object/Vehicle Contacted	00	No object/vehicle contacted	more
V529 — Primary CDC Case Vehicle -event Number	1	Event 1	more
V530 — Primary CDC Case Vehicle - impact speed	999	Unknown	more
V531 — Primary CDC Case Vehicle - Estimated By	1	Investigator	more
V532 — Primary CDC Case Vehicle -crush	091	—	—
V533 — Primary CDC Case Vehicle -clock #1	12	12 o'clock	more
V534 — Primary CDC Case Vehicle letter 1 #1	06	F - Front	more
V535 — Primary CDC Case Vehicle letter 2 #1	04	D - Distributed (Side or End)	more
V536 — Primary CDC Case Vehicle letter 3 #1	05	E - Everything below belt line	more
V537 — Primary CDC Case Vehicle letter 4 #1	23	W - Wide impact area	more
V538 — Primary CDC Case Vehicle Extent #1	05	Extent 5	more
V539 — Primary CDC Case Vehicle -CDC #1	12FDE W5	—	—
V541 — Primary CDC Case Vehicle letter 1 #2	00	Missing Data/Not applicable	more
V542 — Primary CDC Case Vehicle letter 2 #2	00	Missing Data/Not applicable	more
V543 — Primary CDC Case Vehicle letter 3 #2	00	Missing Data/Not applicable	more
V544 — Primary CDC Case Vehicle letter 4 #2	00	Missing Data/Not applicable	more
V545 — Primary CDC Case Vehicle Extent #2	00	Missing Data/Not applicable	more
V546 — Primary CDC Case Vehicle -CDC #2	9800000	—	—
V547 — Primary CDC Contacted Vehicle - Impact Speed	998	Not Applicable	more
V548 — Primary CDC Contacted Vehicle - Estimated By	1	Investigator	more
V549 — Primary CDC Contacted Vehicle -crush	998	Not Applicable	more
V550 — Primary CDC Contacted Vehicle -clock #1	98	Not Applicable	more
V551 — Primary CDC Contacted Vehicle letter 1 #1	00	Missing Data/Not applicable	more
V552 — Primary CDC Contacted Vehicle letter 2 #1	00	Missing Data/Not applicable	more

V553 — Primary CDC Contacted Vehicle letter 3 #1	00	Missing Data/Not applicable	more
V554 — Primary CDC Contacted Vehicle letter 4 #1	00	Missing Data/Not applicable	more
V555 — Primary CDC Contacted Vehicle Extent #1	00	Missing Data/Not applicable	more
V556 — Primary CDC Contacted Vehicle -CDC #1	9800000	—	—
V558 — Primary CDC Contacted Vehicle letter 1 #2	00	Missing Data/Not applicable	more
V559 — Primary CDC Contacted Vehicle letter 2 #2	00	Missing Data/Not applicable	more
V560 — Primary CDC Contacted Vehicle letter 3 #2	00	Missing Data/Not applicable	more
V561 — Primary CDC Contacted Vehicle letter 4 #2	00	Missing Data/Not applicable	more
V562 — Primary CDC Contacted Vehicle Extent #2	00	Missing Data/Not applicable	more
V563 — Primary CDC Contacted Vehicle -CDC #2	9800000	—	—
V564 — Secondary CDC Case Vehicle - Event No	8	Not applicable	more
V565 — Secondary CDC Case Vehicle - Impact Speed	998	Not Applicable	more
V566 — Secondary CDC Case Vehicle - Estimated By	8	Not applicable (no vehicle/no impact)	more
V567 — Secondary CDC Case Vehicle -crush	998	Not Applicable	more
V568 — Secondary CDC Case Vehicle -clock #1	98	Not Applicable	more
V569 — Secondary CDC Case Vehicle letter 1 #1	00	Missing Data/Not applicable	more
V570 — Secondary CDC Case Vehicle letter 2 #1	00	Missing Data/Not applicable	more
V571 — Secondary CDC Case Vehicle letter 3 #1	00	Missing Data/Not applicable	more
V572 — Secondary CDC Case Vehicle letter 4 #1	00	Missing Data/Not applicable	more
V573 — Secondary CDC Case Vehicle Extent #1	00	Missing Data/Not applicable	more
V574 — Secondary CDC Case Vehicle -CDC #1	9800000	—	—
V576 — Secondary CDC Case Vehicle letter 1 #2	00	Missing Data/Not applicable	more
V577 — Secondary CDC Case Vehicle letter 2 #2	00	Missing Data/Not applicable	more
V578 — Secondary CDC Case Vehicle letter 3 #2	00	Missing Data/Not applicable	more
V579 — Secondary CDC Case Vehicle letter 4 #2	00	Missing Data/Not applicable	more
V580 — Secondary CDC Case Vehicle Extent #2	00	Missing Data/Not applicable	more
V581 — Secondary CDC Case Vehicle -CDC #2	9800000	—	—
V582 — Secondary CDC Contacted Vehicle - Impact Speed	998	Not Applicable	more
V583 — Secondary CDC Contacted Vehicle -	8	Not applicable (no vehicle/no	more

Estimated By		impact)	
V584 — Secondary CDC Contacted Vehicle -crush	998	Not Applicable	more
V585 — Secondary CDC Contacted Vehicle -clock #1	98	Not Applicable	more
V586 — Secondary CDC Contacted Vehicle letter 1 #1	00	Missing Data/Not applicable	more
V587 — Secondary CDC Contacted Vehicle letter 2 #1	00	Missing Data/Not applicable	more
V588 — Secondary CDC Contacted Vehicle letter 3 #1	00	Missing Data/Not applicable	more
V589 — Secondary CDC Contacted Vehicle letter 4 #1	00	Missing Data/Not applicable	more
V590 — Secondary CDC Contacted Vehicle Extent #1	00	Missing Data/Not applicable	more
V591 — Secondary CDC Contacted Vehicle -CDC #1	9800000	—	—
V593 — Secondary CDC Contacted Vehicle letter 1 #2	00	Missing Data/Not applicable	more
V594 — Secondary CDC Contacted Vehicle letter 2 #2	00	Missing Data/Not applicable	more
V595 — Secondary CDC Contacted Vehicle letter 3 #2	00	Missing Data/Not applicable	more
V596 — Secondary CDC Contacted Vehicle letter 4 #2	00	Missing Data/Not applicable	more
V597 — Secondary CDC Contacted Vehicle Extent #2	00	Missing Data/Not applicable	more
V598 — Secondary CDC Contacted Vehicle -CDC #2	9800000	—	—

Crash Severity

Variable Number and Name	Code Value	Code Description	Other Options
V601 — Case Vehicle Primary Impact Number	1	—	—
V602 — Primary Impact Total Delta-V	060 kph	—	—
V603 — Primary Case Vehicle Reconstructed Longitudinal Delta-V	-060 kph	—	—
V604 — Primary Case Vehicle Reconstructed Lateral Delta-V	0000 kph	—	—
V605 — Primary Case Vehicle Reconstructed Crush Energy	2028 kJ	—	—
V606 — Primary Impact Case Vehicle - reconstruction	22	Reconstructed, moderate confidence level	more
V607 — Primary Case Vehicle Reconstruction Mode	2	CDC & detailed damage	more
V608 — Primary Contacted Vehicle Reconstructed Total Delta-V	888	N/A	more
V609 — Primary Contacted Vehicle Reconstructed Longitudinal Delta-V	8888	—	—
V610 — Primary Contacted Vehicle Reconstructed Lateral Delta-V	8888	—	—
V611 — Primary Contacted Vehicle Reconstructed Crush Energy	8888	—	—
V612 — Case Vehicle Secondary Impact Number	8	—	—
V613 — Secondary Case Vehicle Reconstructed Total Delta-V	888	N/A	more
V614 — Secondary Case Vehicle Reconstructed Longitudinal Delta-V	8888	—	—
V615 — Secondary Case Vehicle Reconstructed Lateral Delta-V	8888	—	—
V616 — Secondary Case Vehicle Reconstructed Crush Energy	8888	—	—
V617 — Secondary Case Vehicle Reconstruction Note	88	—	—
V618 — Secondary Case Vehicle Reconstruction Mode	8	Not applicable	more
V619 — Secondary Contacted Vehicle Reconstructed Total Delta-V	888	N/A	more

V620 — Secondary Contacted Vehicle Reconstructed Longitudinal Delta-V	8888	—	—
V621 — Secondary Contacted Vehicle Reconstructed Lateral Delta-V	8888	—	—
V622 — Secondary Contacted Vehicle Reconstructed Crush Energy	8888	—	—
V623 — Case Vehicle Primary Impact Number	1	—	—
V624 — Primary Case Vehicle Reconstructed Total EBS	060 kph	—	—
V625 — Primary Case Vehicle Reconstructed Longitudinal EBS	-060 kph	—	—
V626 — Primary Case Vehicle Reconstructed Lateral EBS	0000 kph	—	—
V627 — Primary Case Vehicle Reconstructed Crush Energy	2028 kJ	—	—
V628 — Primary Case Vehicle Reconstruction Note	22	Reconstructed, moderate confidence level	more
V629 — Primary Case Vehicle Reconstruction Mode	2	CDC & detailed damage	more
V630 — Primary Contacted Vehicle Reconstruction Total EBS	888	N/A	more
V631 — Primary Contacted Vehicle Reconstruction Longitudinal EBS	8888	—	—
V632 — Primary Contacted Vehicle Reconstruction Lateral EBS	8888	—	—
V633 — Primary Contacted Vehicle Reconstruction Crush Energy	8888	—	—
V634 — Case Vehicle Secondary Impact Number	8	Not applicable	more
V635 — Secondary Case Vehicle Reconstruction Total EBS	888	N/A	more
V636 — Secondary Case Vehicle Reconstruction Longitudinal EBS	8888	—	—
V637 — Secondary Case Vehicle Reconstruction Lateral EBS	8888	—	—
V638 — Secondary Case Vehicle Reconstruction Crush Energy	8888	—	—
V639 — Secondary Case Vehicle Reconstruction Note	88	—	—
V640 — Secondary Case Vehicle Reconstruction Mode	8	Not applicable	more

V641 — Secondary Contacted Vehicle Reconstruction Total EBS	888	N/A	more
V642 — Secondary Contacted Vehicle Reconstruction Longitudinal EBS	8888	—	—
V643 — Secondary Contacted Vehicle Reconstruction Lateral EBS	8888	—	—
V644 — Secondary Contacted Vehicle Reconstruction Crush Energy	8888	—	—
V645 — Case Vehicle Reconstructed Impact Number	1	—	—
V646 — Case Vehicle Impact 1 Plane	1	Bumper	more
V647 — Case Vehicle Impact 1 Direct Damage Length [DDL]	105 cm	—	—
V648 — Case Vehicle Impact 1 Max Crush	091 cm	—	—
V649 — Case Vehicle Impact 1 Field-L	141 cm	—	—
V650 — Case Vehicle Impact 1 C1	063 cm	—	—
V651 — Case Vehicle Impact 1 C2	078 cm	—	—
V652 — Case Vehicle Impact 1 C3	089 cm	—	—
V653 — Case Vehicle Impact 1 C4	064 cm	—	—
V654 — Case Vehicle Impact 1 C5	037 cm	—	—
V655 — Case Vehicle Impact 1 C6	018 cm	—	—
V656 — Case Vehicle Impact 1 +/- D	0023 cm	—	—
V657 — Case Vehicle Reconstructed Impact Number	9	Unknown	more
V658 — Case Vehicle Impact 2 Plane	9	Unknown	more
V659 — Case Vehicle Impact 2 Direct Damage Length [DDL]	999	Unknown	more
V660 — Case Vehicle Impact 2 Max Crush	999	Unknown	more
V661 — Case Vehicle Impact 2 Field-L	999	Unknown	more
V662 — Case Vehicle Impact 2 C1	999	Unknown	more
V663 — Case Vehicle Impact 2 C2	999	Unknown	more
V664 — Case Vehicle Impact 2 C3	999	Unknown	more
V665 — Case Vehicle Impact 2 C4	999	Unknown	more
V666 — Case Vehicle Impact 2 C5	999	Unknown	more

V667 — Case Vehicle Impact 2 C6	999	Unknown	more
V668 — Case Vehicle Impact 2 +/- D	9999	—	—
V669 — Other Vehicle Reconstructed Impact Number	9	Unknown	more
V670 — Other Vehicle Impact 1 Plane	9	Unknown	more
V671 — Other Vehicle Impact 1 Direct Damage Length [DDL]	999	Unknown	more
V672 — Other Vehicle Impact 1 Max Crush	999	Unknown	more
V673 — Other Vehicle Impact 1 Field-L	999	Unknown	more
V674 — Other Vehicle Impact 1 C1	999	Unknown	more
V675 — Other Vehicle Impact 1 C2	999	Unknown	more
V676 — Other Vehicle Impact 1 C3	999	Unknown	more
V677 — Other Vehicle Impact 1 C4	999	Unknown	more
V678 — Other Vehicle Impact 1 C5	999	Unknown	more
V679 — Other Vehicle Impact 1 C6	999	Unknown	more
V680 — Other Vehicle Impact 1 +/- D	9999	—	—
V681 — Other Vehicle Reconstructed Impact Number	9	Unknown	more
V682 — Other Vehicle Impact 2 Plane	9	Unknown	more
V683 — Other Vehicle Impact 2 Direct Damage Length [DDL]	999	Unknown	more
V684 — Other Vehicle Impact 2 Max Crush	999	Unknown	more
V685 — Other Vehicle Impact 2 Field-L	999	Unknown	more
V686 — Other Vehicle Impact 2 C1	999	Unknown	more
V687 — Other Vehicle Impact 2 C2	999	Unknown	more
V688 — Other Vehicle Impact 2 C3	999	Unknown	more
V689 — Other Vehicle Impact 2 C4	999	Unknown	more
V690 — Other Vehicle Impact 2 C5	999	Unknown	more
V691 — Other Vehicle Impact 2 C6	999	Unknown	more
V692 — Other Vehicle Impact 2 +/- D	9999	—	—

Case Vehicle

Tires & Rims

Variable Number and Name	Code Value	Code Description	Other Options
V701 — Left Front Wheel Damaged	1	Yes	more
V702 — Right Front Wheel Damaged	1	Yes	more
V703 — Right Rear Wheel Damaged	0	No	more
V704 — Left Rear Wheel Damaged	0	No	more
V705 — Left Front Tire Tread Type	4	All Weather	more
V706 — Right Front Tire Tread Type	4	All Weather	more
V707 — Right Rear Tire Tread Type	4	All Weather	more
V708 — Left Rear Tire Tread Type	4	All Weather	more
V709 — Left Front Carcass Construction	4	Elliptical	more
V710 — Right Front Carcass Construction	4	Elliptical	more
V711 — Right Rear Carcass Construction	4	Elliptical	more
V712 — Left Rear Carcass Construction	4	Elliptical	more
V717 — Left Front Tire Size	9999999999	—	—
V718 — Right Front Tire Size	9999999999	—	—
V719 — Right Rear Tire Size	9999999999	—	—
V720 — Left Rear Tire Size	9999999999	—	—

Case Vehicle

Fuel, Tank, Fire

Variable Number and Name	Code Value	Code Description	Other Options
V801 — Propulsive Fuel Type	1	Gasoline	more
V802 — Main Tank Location	322	Within frame/centered laterally - within vertically	more
V803 — Main Filler Cap Location	113	Left of frame laterally - above vertically	more
V804 — Main Tank Material	3	Plastic	more
V805 — Aux Tank Type	8	Not applicable (not equipped)	more
V806 — Aux Tank Location	888	Not applicable (not equipped)	more
V807 — Aux Filler Cap Location	888	Not applicable (not equipped)	more
V808 — Aux Tank Material	8	Not applicable	more
V901 — Fuel Leakage From Crash	0	No	more
V1001 — Fire In Or On Case Vehicle	0	No	more

Case Vehicle

Exterior

Variable Number and Name	Code Value	Code Description	Other Options
V1101 — Hood Latch Released	0	No	more
V1102 — Hood Latch Damaged	1	Yes	more
V1103 — Hood Latch Jammed	1	Yes	more
V1104 — Left Hood Hinge Damaged	1	Yes	more
V1105 — Left Hood Hinge Separated	0	No	more
V1106 — Right Hood Hinge Damaged	1	Yes	more
V1107 — Right Hood Hinge Separated	0	No	more
V1108 — Hood Remained On Vehicle	1	Yes	more
V1109 — Rear Hood Edge Elevated	1	Yes	more
V1110 — Edge Contacted Windshield	9	Unknown	more
V1111 — Edge Penetrated Windshield	9	Unknown	more
V1112 — Hood Latch Location	1	Front of Vehicle	more
V1113 — Eng/Transmissn Mount Separation	0	No	more
V1114 — Steerng Column Flex Coupling	9	Unknown if equipped	more
V1115 — Steerng Column Coupling Damaged	9	Unknown	more
V1116 — Steerng Column Coupling Separated	9	Unknown	more
V1117 — Eng Comp Telescopng Unit	88	Not collected	more
V1118 — Comp Orig/Telescopd Diff	888	Not collected	more
V1119 — Left Side Body Mount Separation	8	Not applicable (unitized)	more
V1120 — Upper Left A-pillar Separation	4	No separation, but damaged	more
V1121 — Lower Left A-pillar Separation	4	No separation, but damaged	more
V1122 — Upper Left B-pillar Separation	0	No	more
V1123 — Lower Left B-pillar Separation	0	No	more
V1124 — Upper Left C-pillar Separation	0	No	more

V1125 — Lower Left C-pillar Separation	0	No	more
V1126 — Upper Left D-pillar Separation	8	Not applicable (not equipped)	more
V1127 — Lower Left D-pillar Separation	8	Not applicable (not equipped)	more
V1128 — Left Front Door Opening Cause	0	Door did not open	more
V1129 — Left Rear Door Opening Cause	0	Door did not open	more
V1130 — Left Front Door Jammed Closed	1	Yes	more
V1131 — Left Rear Door Jammed Closed	0	No	more
V1132 — Rear Door Type	0	No door (includes pickups)	more
V1133 — Rear Door Opening Cause	8	Not applicable (no rear door)	more
V1134 — Rear Door Jammed Closed	8	Not applicable (no rear door)	more
V1135 — Luggage Partition Damagd	1	Yes	more
V1136 — Spare Tire Status	8	Not collected	more
V1137 — Trailer Hitch Type	0	No hitch	more
V1138 — Trailer Type	0	No trailer	more
V1139 — Right Side Body Mount Separation	8	Not applicable (unitized)	more
V1140 — Upper Right A-pillar Separation	0	No	more
V1141 — Lower Right A-pillar Separation	4	No separation, but damaged	more
V1142 — Upper Right B-pillar Separation	0	No	more
V1143 — Lower Right B-pillar Separation	0	No	more
V1144 — Upper Right C-pillar Separation	0	No	more
V1145 — Lower Right C-pillar Separation	0	No	more
V1146 — Upper Right D-pillar Separation	8	Not applicable (not equipped)	more
V1147 — Lower Right D-pillar Separation	8	Not applicable (not equipped)	more
V1148 — Right Front Door Opening Cause	00	Door did not open	more
V1149 — Right Rear Door Opening Cause	00	Door did not open	more
V1150 — Right Front Door Jammed Closed	1	Yes	more

V1151 — Right Rear Door Jammed Closed	0	No	more
V1152 — Van Rear Door Type	8	Not applicable (not a van)	more
V1153 — Windshield Cracked		Yes	more
V1154 — Windshield Broken	0	No	more
V1155 — Windshield Cracked or Broken by Occupant	0	No	more
V1156 — Bond Separation Extent	0	None	more
V1157 — Windshield Code		—	—
V1158 — Did Sun/T Roof Open	8	Not Applicable	more

Case Vehicle

Steering

Column/Rim

Variable Number and Name	Code Value	Code Description	Other Options
V1201 — Steering Wheel Rim Damage	2	Severely bent	more
V1202 — Number of Steering Wheel Spokes	4	4 spokes	more
V1203 — Steering Wheel Spoke Damage	1	Deformed slightly	more
V1204 — Column Tilt Feature	1	Yes, equipped (position unknown)	more
V1205 — Column Swing-away Feature	0	Not equipped	more
V1206 — Column Telescoping Feature	0	Not equipped	more
V1207 — Wheel Energy Absorb Device	8	Not collected	more
V1208 — Wheel Ea Orig/Damaged Diff	888	Not collected	more
V1209 — Column Energy Absorb Device	88	Not collected	more
V1210 — Column Ea Orig/Comprss Diff	888	Not collected	more
V1211 — Shear Capsule Separation	888	Not collected	more
V1212 — Column Vertical Rotation	1	Upward apparent rotation	more
V1213 — Column Lateral Rotation	1	Left apparent rotation	more
V1214 — Steering Wheel Hub Damage	3	Other	more

Case Vehicle

Intrusion

Variable Number and Name	Code Value	Code Description	Other Options
V1301 — Occupant Compartment Intrusion	1	Yes	more
V1302 — Was Intrusion Catastrophic	0	No	more
V1303 — Intrusion Number 01	01	Intrusion #1	more
V1304 — Intrusion 01 Occupant Space Number	11	First row, Left seat	more
V1305 — Intrusion 01 Intruding Object	03	Toe pan	more
V1306 — Intrusion 01 Assoc Event Number	1	Event #1	more
V1307 — Intrusion 01 Max Intrusion X-axis	49 cm	—	—
V1308 — Intrusion 01 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	more
V1309 — Intrusion 01 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	more
V1310 — Intrusion 01 Occupant Number	01	Occupant number 1, contact	more
V1311 — Intrusion 01 Injury Number	15	Injury #15	more
V1312 — Intrusion 01 Occupant Number	01	Occupant number 1, contact	more
V1313 — Intrusion 01 Injury Number	16	Injury #16	more
V1314 — Intrusion Number 02	02	Intrusion #2	more
V1315 — Intrusion 02 Occupant Space Number	11	First row, Left seat	more
V1316 — Intrusion 02 Intruding Object	01	Instrument panel	more
V1317 — Intrusion 02 Assoc Event Number	1	Event #1	more
V1318 — Intrusion 02 Max Intrusion X-axis	21 cm	—	—
V1319 — Intrusion 02 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	more
V1320 — Intrusion 02 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	more
V1321 — Intrusion 02 Occupant Number	01	Occupant number 1, contact	more
V1322 — Intrusion 02 Injury Number	13	Injury #13	more
V1323 — Intrusion 02 Occupant Number	01	Occupant number 1, contact	more
V1324 — Intrusion 02 Injury Number	14	Injury #14	more
V1325 — Intrusion Number 03	03	Intrusion #3	more

V1326 — Intrusion 03 Occupant Space Number	11	First row, Left seat	more
V1327 — Intrusion 03 Intruding Object	05	Steering column	more
V1328 — Intrusion 03 Assoc Event Number	1	Event #1	more
V1329 — Intrusion 03 Max Intrusion X-axis	15 cm	—	—
V1330 — Intrusion 03 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	more
V1331 — Intrusion 03 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	more
V1332 — Intrusion 03 Occupant Number	01	Occupant number 1, contact	more
V1333 — Intrusion 03 Injury Number	02	Injury #2	more
V1334 — Intrusion 03 Occupant Number	01	Occupant number 1, contact	more
V1335 — Intrusion 03 Injury Number	03	Injury #3	more
V1336 — Intrusion Number 04	04	Intrusion #4	more
V1337 — Intrusion 04 Occupant Space Number	13	First row, Right seat	more
V1338 — Intrusion 04 Intruding Object	03	Toe pan	more
V1339 — Intrusion 04 Assoc Event Number	1	Event #1	more
V1340 — Intrusion 04 Max Intrusion X-axis	46 cm	—	—
V1341 — Intrusion 04 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	more
V1342 — Intrusion 04 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	more
V1343 — Intrusion 04 Occupant Number	00	No contact or no intrusion	more
V1344 — Intrusion 04 Injury Number	00	No injury or no intrusion	more
V1345 — Intrusion 04 Occupant Number	00	No contact or no intrusion	more
V1346 — Intrusion 04 Injury Number	00	No injury or no intrusion	more
V1347 — Intrusion Number 05	05	Intrusion #5	more
V1348 — Intrusion 05 Occupant Space Number	13	First row, Right seat	more
V1349 — Intrusion 05 Intruding Object	01	Instrument panel	more
V1350 — Intrusion 05 Assoc Event Number	1	Event #1	more
V1351 — Intrusion 05 Max Intrusion X-axis	18 cm	—	—
V1352 — Intrusion 05 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	more
V1353 — Intrusion 05 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	more
V1354 — Intrusion 05 Occupant Number	00	No contact or no intrusion	more
V1355 — Intrusion 05 Injury Number	00	No injury or no intrusion	more

V1356 — Intrusion 05 Occupant Number	00	No contact or no intrusion	more
V1357 — Intrusion 05 Injury Number	00	No injury or no intrusion	more
V1358 — Intrusion Number 06	06	Intrusion #6	more
V1359 — Intrusion 06 Occupant Space Number	13	First row, Right seat	more
V1360 — Intrusion 06 Intruding Object	04	Floor pan	more
V1361 — Intrusion 06 Assoc Event Number	1	Event #1	more
V1362 — Intrusion 06 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	more
V1363 — Intrusion 06 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	more
V1364 — Intrusion 06 Max Intrusion Z-axis	12 cm	—	—
V1365 — Intrusion 06 Occupant Number	00	No contact or no intrusion	more
V1366 — Intrusion 06 Injury Number	00	No injury or no intrusion	more
V1367 — Intrusion 06 Occupant Number	00	No contact or no intrusion	more
V1368 — Intrusion 06 Injury Number	00	No injury or no intrusion	more
V1369 — Intrusion Number 07	07	Intrusion #7	more
V1370 — Intrusion 07 Occupant Space Number	22	Second row, Center seat	more
V1371 — Intrusion 07 Intruding Object	18	Second seat-back surface / seat-back back surface	more
V1372 — Intrusion 07 Assoc Event Number	1	Event #1	more
V1373 — Intrusion 07 Max Intrusion X-axis	25 cm	—	—
V1374 — Intrusion 07 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	more
V1375 — Intrusion 07 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	more
V1376 — Intrusion 07 Occupant Number	00	No contact or no intrusion	more
V1377 — Intrusion 07 Injury Number	00	No injury or no intrusion	more
V1378 — Intrusion 07 Occupant Number	00	No contact or no intrusion	more
V1379 — Intrusion 07 Injury Number	00	No injury or no intrusion	more
V1380 — Intrusion Number 08	00	No Intrusion, None	more
V1381 — Intrusion 08 Occupant Space Number	00	No Intrusion, None	more
V1382 — Intrusion 08 Intruding Object	00	No Intrusion, None	more
V1383 — Intrusion 08 Assoc Event Number	0	No Intrusion, None	more
V1384 — Intrusion 08 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	more

V1385 — Intrusion 08 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	more
V1386 — Intrusion 08 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	more
V1387 — Intrusion 08 Occupant Number	00	No contact or no intrusion	more
V1388 — Intrusion 08 Injury Number	00	No injury or no intrusion	more
V1389 — Intrusion 08 Occupant Number	00	No contact or no intrusion	more
V1390 — Intrusion 08 Injury Number	99	Contact, injury unknown or data not collected	more
V1391 — Intrusion Number 09	00	No Intrusion, None	more
V1392 — Intrusion 09 Occupant Space Number	00	No Intrusion, None	more
V1393 — Intrusion 09 Intruding Object	00	No Intrusion, None	more
V1394 — Intrusion 09 Assoc Event Number	0	No Intrusion, None	more
V1395 — Intrusion 09 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	more
V1396 — Intrusion 09 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	more
V1397 — Intrusion 09 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	more
V1398 — Intrusion 09 Occupant Number	00	No contact or no intrusion	more
V1399 — Intrusion 09 Injury Number	00	No injury or no intrusion	more
V1400 — Intrusion 09 Occupant Number	00	No contact or no intrusion	more
V1401 — Intrusion 09 Injury Number	99	Contact, injury unknown or data not collected	more
V1402 — Intrusion Number 10	00	No Intrusion, None	more
V1403 — Intrusion 10 Occupant Space Number	00	No Intrusion, None	more
V1404 — Intrusion 10 Intruding Object	00	No Intrusion, None	more
V1405 — Intrusion 10 Assoc Event Number	0	No Intrusion, None	more
V1406 — Intrusion 10 Max Intrusion X-axis	00 cm	0 cm or No Intrusion	more
V1407 — Intrusion 10 Max Intrusion Y-axis	00 cm	0 cm or No Intrusion	more
V1408 — Intrusion 10 Max Intrusion Z-axis	00 cm	0 cm or No Intrusion	more
V1409 — Intrusion 10 Occupant Number	00	No contact or no intrusion	more
V1410 — Intrusion 10 Injury Number	00	No injury or no intrusion	more
V1411 — Intrusion 10 Occupant Number	00	No contact or no intrusion	more
V1412 — Intrusion 10 Injury Number	99	Contact, injury unknown or data not collected	more

V1413 — Door Intrusion Number 01	88	Not Applicable	more
V1414 — Door Intrusion Number 01 Cause	8	Not applicable	more
V1415 — Door Intrusion Number 02	88	Not Applicable	more
V1416 — Door Intrusion Number 02 Cause	8	Not applicable	more
V1417 — Door Intrusion Number 03	88	Not Applicable	more
V1418 — Door Intrusion Number 03 Cause	8	Not applicable	more
V1419 — Door Intrusion 01 Component	88	Not Applicable	more
V1420 — Door Intrusion 01 Component Damaged 1	8	Not Applicable	more
V1421 — Door Intrusion 01 Component Damaged 2	8	Not Applicable	more
V1422 — Door Intrusion 02 Component	88	Not Applicable	more
V1423 — Door Intrusion 02 Component Damaged 1	8	Not Applicable	more
V1424 — Door Intrusion 02 Component Damaged 2	8	Not Applicable	more
V1425 — Door Intrusion 03 Component	88	Not Applicable	more
V1426 — Door Intrusion 03 Component Damaged 1	8	Not Applicable	more
V1427 — Door Intrusion 03 Component Damaged 2	8	Not Applicable	more
V1428 — Door Intrusion 04 Component	88	Not Applicable	more
V1429 — Door Intrusion 04 Component Damaged 1	8	Not Applicable	more
V1430 — Door Intrusion 04 Component Damaged 2	8	Not Applicable	more

Case Vehicle

Airbag(s)

Variable Number and Name	Code Value	Code Description	Other Options
V1501 — Driver Airbag Equipped	1	Yes	more
V1502 — Driver Airbag Deployed	1	Yes	more
V1503 — Driver Airbag Condition	6	Other	more
V1504 — Passenger Airbag Equip	1	Yes	more
V1505 — Passenger Airbag Deployed	1	Yes	more
V1506 — Passenger Airbag Condition	0	No Damage	more
V1507 — Steering Wheel Airbag Tether	1	Yes	more
V1508 — Driver Airbag Marked By Contact	1	Yes	more
V1509 — Passenger Airbag Tether	0	No	more
V1510 — Passenger Airbag Marked By Contact	0	No	more

Case Vehicle

Interior

Variable Number and Name	Code Value	Code Description	Other Options
V1601 — Left Front Door Damaged	1	Yes	more
V1602 — Right Front Door Damaged	0	No	more
V1603 — Left Front Hardware Damaged	1	Yes	more
V1604 — Right Front Hardware Damaged	0	No	more
V1605 — Left Front Armrest Damaged	1	Yes	more
V1606 — Right Front Armrest Damaged	0	No	more
V1607 — Left Front Glass Damaged	1	Yes	more
V1608 — Right Front Glass Damaged	0	No	more
V1609 — Left Rear Door Area Damaged	0	No	more
V1610 — Right Rear Door Area Damaged	0	No	more
V1611 — Left Rear Hardware Damaged	0	No	more
V1612 — Right Rear Hardware Damaged	0	No	more
V1613 — Left Rear Armrest Damaged	0	No	more
V1614 — Right Rear Armrest Damaged	0	No	more
V1615 — Left Rear Glass Damaged	0	No	more
V1616 — Right Rear Glass Damaged	0	No	more
V1617 — Left Roof Side Rail Damaged	1	Yes	more
V1618 — Right Roof Side Rail Damaged	0	No	more
V1619 — Left B-pillar Damaged	0	No	more
V1620 — Right B-pillar Damaged	0	No	more
V1621 — Left C-pillar Damaged	0	No	more
V1622 — Right C-pillar Damaged	0	No	more
V1623 — Left D-pillar Damaged	8	Not applicable	more
V1624 — Right D-pillar Damaged	8	Not applicable	more
V1625 — Left Headlining Damaged	1	Yes	more

V1626 — Right Headlining Damaged	0	No	more
V1627 — Left Roof Structure Damaged	1	Yes	more
V1628 — Right Roof Structure Damaged	0	No	more
V1629 — Left T/Sun Roof Damaged	8	Not applicable	more
V1630 — Right T/Sun Roof Damaged	8	Not applicable	more
V1631 — Other Left Side Item Damagd	8	Not applicable	more
V1632 — Other Right Side Item Damagd	8	Not applicable	more
V1633 — Foot Controls Damaged	4	Yes, occupant contact	more
V1634 — Ignition Key Damaged	4	Yes, occupant contact	more
V1635 — Rear View Mirror Damaged	9	Unknown	more
V1636 — Sunvisor/Fitting Damaged	0	No	more
V1637 — Windshield Molding Damaged	0	No	more
V1638 — Left A-pillar Damaged	1	Yes	more
V1639 — Right A-pillar Damaged	0	No	more
V1640 — Center Console Damaged	1	Yes	more
V1641 — Transmission Lever Damaged	0	No	more
V1642 — Horn/Spoke Shroud Damagd	0	No	more
V1643 — Upper Panel Damaged	4	Yes, occupant contact	more
V1644 — Mid Panel Damaged	1	Yes	more
V1645 — Lower Panel Damaged	4	Yes, occupant contact	more
V1646 — Ashtray Damaged	1	Yes	more
V1647 — Control Knob/Lever Damaged	4	Yes, occupant contact	more
V1648 — Glove Compartment Area Damaged	1	Yes	more
V1649 — Instruments Damaged	0	No	more
V1650 — Park Brake Release Damaged	0	No	more
V1651 — Park Brake Pedal Damaged	1	Yes	more
V1652 — A/C Or Upper Vent Damaged	0	No	more
V1653 — Heater Or A/C Duct Damaged	0	No	more
V1654 — Radio Damaged	0	No	more

V1655 — Other Item Damaged	8	Not applicable	more
V1656 — Rear Window Damaged	0	No	more
V1657 — Rear Window Header Damaged	0	No	more
V1658 — Vertical Console Damaged	1	Yes	more
V1659 — Roof Console Damaged	8	Not applicable	more

Case Vehicle

Seats

Variable Number and Name	Code Value	Code Description	Other Options
V1701 — Driver Front Seat Type	05	Bucket	more
V1702 — Passenger Front Seat Type	05	Bucket	more
V1703 — Driver Seat Mount Type	1	Standard	more
V1704 — Passenger Seat Mount Type	1	Standard	more
V1705 — Driver Swivel Mechanism Equipped	0	No	more
V1706 — Passenger Swivel Mechanism Equipped	0	No	more
V1707 — Driver Seat Original Equipment	1	Yes	more
V1708 — Passenger Seat Original Equipment	1	Yes	more
V1709 — Driver Seat/Rear Occupant Contact	8	Not applicable	more
V1710 — Passenger Seat/Rear Occupant Contact	8	Not applicable	more
V1711 — Driver Seat Damage	3	Backrest and cushion damaged	more
V1712 — Passenger Seat Damage	0	None	more
V1713 — Center Front Armrest Damaged	1	Yes	more
V1714 — Driver Seat Rotation	1	Forward apparent	more
V1715 — Passenger Seat Rotation	0	None apparent	more
V1716 — Driver Seat-back Type	3	Reclining	more
V1717 — Passenger Seat-back Type	3	Reclining	more
V1718 — Driver Seat-back Lock Type	1	Manual	more
V1719 — Passenger Seat-back Lock Type	1	Manual	more
V1720 — Driver Seat-back Lock Held	1	Yes	more
V1721 — Passenger Seat-back Lock Held	1	Yes	more

V1722 — Driver Recliner Mechanism Held	1	Yes	more
V1723 — Passenger Recliner Mechanism Held	1	Yes	more
V1724 — Driver Head Restraint Type	1	Adjustable	more
V1725 — Passenger Head Restraint Type	1	Adjustable	more
V1726 — Driver Head Rest Removed	0	No	more
V1727 — Passenger Head Rest Removed	0	No	more
V1728 — Driver Head Rest Adjustment	2	Down	more
V1729 — Passenger Head Rest Adjustment	2	Down	more
V1730 — Driver Head Rest Damage	0	None	more
V1731 — Passenger Head Rest Damage	0	None	more
V1732 — Driver Seat Adjustment Type	1	Manual	more
V1733 — Passenger Seat Adjustment Type	1	Manual	more
V1734 — Driver Seat Adjustment Provided	1	2-way	more
V1735 — Passenger Seat Adjustment Provided	1	2-way	more
V1736 — Driver Seat Adjuster Damage	2	Deformed (released/jammed)	more
V1737 — Passenger Seat Adjuster Damage	0	None	more
V1738 — Driver Seat Adjuster Separation	0	None	more
V1739 — Passenger Seat Adjuster Separation	8	Not applicable	more
V1740 — Driver Seat Pre-crash Position	9	Unknown	more
V1741 — Passenger Seat Pre-crash Position	9	Unknown	more
V1742 — Left Rear Seat Type	1	Non-folding	more
V1743 — Right Rear Seat Type	1	Non-folding	more
V1744 — Left Rear Seat Damaged	1	Backrest only (damaged or loosened)	more
V1745 — Right Rear Seat Damaged	1	Backrest only (damaged or loosened)	more

V1746 — Center Rear Armrest Damaged	8	Not applicable (No Center Armrest)	more
V1747 — Left Rear Seat-back Left Lock Equipped	8	Not applicable	more
V1748 — Right Rear Seat-back Left Lock Equipped	8	Not applicable	more
V1749 — Left Rear Seat-back Left Lock Held	8	Not applicable	more
V1750 — Right Rear Seat-back Left Lock Held	8	Not applicable	more
V1751 — Left Rear Seat-back Right Lock Equipped	8	Not applicable	more
V1752 — Right Rear Seat-back Right Lock Equipped	8	Not applicable	more
V1753 — Left Rear Seat-back Right Lock Held	8	Not applicable	more
V1754 — Right Rear Seat-back Right Lock Held	8	Not applicable	more
V1755 — Left 3rd Seat Equipped	0	No	more
V1756 — Right 3rd Seat Equipped	0	No	more
V1757 — Left 3rd Seat Backrest Damaged	8	Not applicable	more
V1758 — Right 3rd Seat Backrest Damaged	8	Not applicable	more
V1759 — Left 3rd Seat Cushion Damaged	8	Not applicable	more
V1760 — Right 3rd Seat Cushion Damaged	8	Not applicable	more
V1761 — Rear Head Restraints	1	Equipped	more

MEASUREMENTS IN CENTIMETERS



Original
Bumper Height



 
Bumper corner
Slingline

Bumper corner
Slingline



105-cm direct damage
max crush is 91-cm

windshield and pillars cut




Bumper corner
Slingline

Bumper corner
Slingline

WINDSHIELD MARK ON CASE VEHICLE:

unknown

 cut and removed by rescue crew



1 = Definitely 2 = Probably 3 = Possible


INTRUSION IT-1

Location of Intrusion	Intruded Component	(All Measurements Are in Centimeters)					Dominant Crush Direction
		Comparison Value	–	Intruded Value	=	Intrusion	
11	Toe pan	118	–	69	=	49	To rear
11	Instrument panel	77	–	56	=	21	To rear
11	Steering column	65	–	50	=	15	To rear
13	Toe pan	118	–	72	=	46	To rear
13	Instrument panel	77	–	59	=	18	To rear
13	Floor		–		=	12	Up
22	Second seat back		–		=	25	forward
			–		=		
			–		=		
			–		=		
			–		=		
			–		=		
			–		=		


OCCUPANT CONTACT WORKSHEET

Contact	Interior Component Contacted	Occupant No. if Known	Body Region if Known	Supporting Physical Evidence	Confidence Level of Contact Point
A	Steering rim	1	Face/head	Top half pushed forward	1
B	Knee bolster	1	Knee	18x3-cm scuff to left side	1
C	Knee bolster	1	Knee	6x5-cm scuff to right side	1
D	Driver door	1	Leg	Scuff	2
E	Ignition key	1	Hand	Pushed forward	2
F	Windshield wiper arm	1	Hand	Pushed forward and broke	2
G	Toe pan	1	Feet	Displacement, shoes stuck	1
H	Foot controls	1	Feet	Shoes stuck	1

 D: Driver door
(scuff)



 Or belt: lower anchorage is on seat track
and seat moved forward in crash
marks on webbing



APR243 NUMBER ON DRIVER SIDE

emergency rescue crew says they did NOT
cut the sitting



Driver Sitting Seats



Notes: (7) 15
if you have more: _____

Notes: (7) 15
if you have more: _____

Passenger Luggage



Model: 1 (1)
 Date: _____

Model: 1 (1)
 Date: _____

Passenger Luggage Skirt

Single Skirt



Case # 324: Occupant # 1; Injury # 1

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	01	Injury #1	more
V2102 — 1st Prob Contact Area	41	Unknown interior surface	more
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	more
V2104 — Primary OIC -body Region	08	Head/skull	more
V2105 — Primary OIC -aspect	18	Right	more
V2106 — Primary OIC -lesion	12	Laceration	more
V2107 — Primary OIC -system/Organ	09	Integumentary	more
V2108 — Primary OIC -severity	1	Minor	more
V2109 — Primary OIC	HRLI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 324: Occupant # 1; Injury # 2

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	02	Injury #2	more
V2102 — 1st Prob Contact Area	65	Steering wheel	more
V2103 — 2nd Prob Contact Area	87	Air cushion skin "airbag"	more
V2104 — Primary OIC -body Region	08	Head/skull	more
V2105 — Primary OIC -aspect	18	Right	more
V2106 — Primary OIC -lesion	21	Unknown	more
V2107 — Primary OIC -system/Organ	02	Brain	more
V2108 — Primary OIC -severity	3	Serious	more
V2109 — Primary OIC	HRUB3	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 324: Occupant # 1; Injury # 3

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	03	Injury #3	more
V2102 — 1st Prob Contact Area	65	Steering wheel	more
V2103 — 2nd Prob Contact Area	87	Air cushion skin "airbag"	more
V2104 — Primary OIC -body Region	08	Head/skull	more
V2105 — Primary OIC -aspect	18	Right	more
V2106 — Primary OIC -lesion	03	Contusion	more
V2107 — Primary OIC -system/Organ	02	Brain	more
V2108 — Primary OIC -severity	3	Serious	more
V2109 — Primary OIC	HRCB3	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 324: Occupant # 1; Injury # 4

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	04	Injury #4	more
V2102 — 1st Prob Contact Area	65	Steering wheel	more
V2103 — 2nd Prob Contact Area	87	Air cushion skin "airbag"	more
V2104 — Primary OIC -body Region	06	Face	more
V2105 — Primary OIC -aspect	12	Left	more
V2106 — Primary OIC -lesion	06	Fracture	more
V2107 — Primary OIC -system/Organ	19	Skeletal	more
V2108 — Primary OIC -severity	2	Moderate	more
V2109 — Primary OIC	FLFS2	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 324: Occupant # 1; Injury # 5

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	05	Injury #5	more
V2102 — 1st Prob Contact Area	65	Steering wheel	more
V2103 — 2nd Prob Contact Area	87	Air cushion skin "airbag"	more
V2104 — Primary OIC -body Region	06	Face	more
V2105 — Primary OIC -aspect	09	Inferior/lower	more
V2106 — Primary OIC -lesion	12	Laceration	more
V2107 — Primary OIC -system/Organ	09	Integumentary	more
V2108 — Primary OIC -severity	1	Minor	more
V2109 — Primary OIC	FILI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 324: Occupant # 1; Injury # 6

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	06	Injury #6	more
V2102 — 1st Prob Contact Area	65	Steering wheel	more
V2103 — 2nd Prob Contact Area	87	Air cushion skin "airbag"	more
V2104 — Primary OIC -body Region	06	Face	more
V2105 — Primary OIC -aspect	09	Inferior/lower	more
V2106 — Primary OIC -lesion	06	Fracture	more
V2107 — Primary OIC -system/Organ	19	Skeletal	more
V2108 — Primary OIC -severity	1	Minor	more
V2109 — Primary OIC	FIFS1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 324: Occupant # 1; Injury # 7

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	07	Injury #7	more
V2102 — 1st Prob Contact Area	65	Steering wheel	more
V2103 — 2nd Prob Contact Area	87	Air cushion skin "airbag"	more
V2104 — Primary OIC -body Region	06	Face	more
V2105 — Primary OIC -aspect	09	Inferior/lower	more
V2106 — Primary OIC -lesion	06	Fracture	more
V2107 — Primary OIC -system/Organ	19	Skeletal	more
V2108 — Primary OIC -severity	1	Minor	more
V2109 — Primary OIC	FIFS1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 324: Occupant # 1; Injury # 8

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	08	Injury #8	more
V2102 — 1st Prob Contact Area	40	Floor	more
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	more
V2104 — Primary OIC -body Region	17	Ankle/foot	more
V2105 — Primary OIC -aspect	18	Right	more
V2106 — Primary OIC -lesion	06	Fracture	more
V2107 — Primary OIC -system/Organ	19	Skeletal	more
V2108 — Primary OIC -severity	2	Moderate	more
V2109 — Primary OIC	QRFS2	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 324: Occupant # 1; Injury # 9

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	09	Injury #9	more
V2102 — 1st Prob Contact Area	87	Air cushion skin "airbag"	more
V2103 — 2nd Prob Contact Area	65	Steering wheel	more
V2104 — Primary OIC -body Region	03	Chest	more
V2105 — Primary OIC -aspect	18	Right	more
V2106 — Primary OIC -lesion	03	Contusion	more
V2107 — Primary OIC -system/Organ	16	Pulmonary/lungs	more
V2108 — Primary OIC -severity	3	Serious	more
V2109 — Primary OIC	CRCP3	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 324: Occupant # 1; Injury #10

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	10	Injury #10	more
V2102 — 1st Prob Contact Area	34	Restraint system webbing	more
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	more
V2104 — Primary OIC -body Region	13	Abdomen	more
V2105 — Primary OIC -aspect	12	Left	more
V2106 — Primary OIC -lesion	01	Abrasion	more
V2107 — Primary OIC -system/Organ	09	Integumentary	more
V2108 — Primary OIC -severity	1	Minor	more
V2109 — Primary OIC	MLAI 1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 324: Occupant # 1; Injury #11

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	11	Injury #11	more
V2102 — 1st Prob Contact Area	34	Restraint system webbing	more
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	more
V2104 — Primary OIC -body Region	13	Abdomen	more
V2105 — Primary OIC -aspect	12	Left	more
V2106 — Primary OIC -lesion	03	Contusion	more
V2107 — Primary OIC -system/Organ	09	Integumentary	more
V2108 — Primary OIC -severity	1	Minor	more
V2109 — Primary OIC	MLCI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 324: Occupant # 1; Injury #12

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	12	Injury #12	more
V2102 — 1st Prob Contact Area	83	Control knob(s) and lever(s) (front)	more
V2103 — 2nd Prob Contact Area	67	Ignition key	more
V2104 — Primary OIC -body Region	23	Wrist/hand	more
V2105 — Primary OIC -aspect	18	Right	more
V2106 — Primary OIC -lesion	12	Laceration	more
V2107 — Primary OIC -system/Organ	09	Integumentary	more
V2108 — Primary OIC -severity	1	Minor	more
V2109 — Primary OIC	WRLI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 324: Occupant # 1; Injury #13

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	13	Injury #13	more
V2102 — 1st Prob Contact Area	48	Knee restraint	more
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	more
V2104 — Primary OIC -body Region	11	Knee	more
V2105 — Primary OIC -aspect	12	Left	more
V2106 — Primary OIC -lesion	01	Abrasion	more
V2107 — Primary OIC -system/Organ	09	Integumentary	more
V2108 — Primary OIC -severity	1	Minor	more
V2109 — Primary OIC	KLAI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 324: Occupant # 1; Injury #14

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	14	Injury #14	more
V2102 — 1st Prob Contact Area	48	Knee restraint	more
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	more
V2104 — Primary OIC -body Region	12	Leg (lower)	more
V2105 — Primary OIC -aspect	12	Left	more
V2106 — Primary OIC -lesion	03	Contusion	more
V2107 — Primary OIC -system/Organ	09	Integumentary	more
V2108 — Primary OIC -severity	1	Minor	more
V2109 — Primary OIC	LLCI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 324: Occupant # 1; Injury #15

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	15	Injury #15	more
V2102 — 1st Prob Contact Area	48	Knee restraint	more
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	more
V2104 — Primary OIC -body Region	11	Knee	more
V2105 — Primary OIC -aspect	18	Right	more
V2106 — Primary OIC -lesion	03	Contusion	more
V2107 — Primary OIC -system/Organ	09	Integumentary	more
V2108 — Primary OIC -severity	1	Minor	more
V2109 — Primary OIC	KRCI1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 324: Occupant # 1; Injury #16

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	16	Injury #16	more
V2102 — 1st Prob Contact Area	40	Floor	more
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	more
V2104 — Primary OIC -body Region	17	Ankle/foot	more
V2105 — Primary OIC -aspect	18	Right	more
V2106 — Primary OIC -lesion	04	Dislocation	more
V2107 — Primary OIC -system/Organ	10	Joints	more
V2108 — Primary OIC -severity	1	Minor	more
V2109 — Primary OIC	QRDJ1	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 324: Occupant # 1; Injury #17

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	17	Injury #17	more
V2102 — 1st Prob Contact Area	40	Floor	more
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	more
V2104 — Primary OIC -body Region	17	Ankle/foot	more
V2105 — Primary OIC -aspect	18	Right	more
V2106 — Primary OIC -lesion	26	Fracture with dislocation	more
V2107 — Primary OIC -system/Organ	10	Joints	more
V2108 — Primary OIC -severity	2	Moderate	more
V2109 — Primary OIC	QRZJ2	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 324: Occupant # 1; Injury #18

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	18	Injury #18	more
V2102 — 1st Prob Contact Area	40	Floor	more
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	more
V2104 — Primary OIC -body Region	17	Ankle/foot	more
V2105 — Primary OIC -aspect	18	Right	more
V2106 — Primary OIC -lesion	26	Fracture with dislocation	more
V2107 — Primary OIC -system/Organ	10	Joints	more
V2108 — Primary OIC -severity	2	Moderate	more
V2109 — Primary OIC	QRZJ2	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 324: Occupant # 1; Injury #19

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	19	Injury #19	more
V2102 — 1st Prob Contact Area	40	Floor	more
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	more
V2104 — Primary OIC -body Region	17	Ankle/foot	more
V2105 — Primary OIC -aspect	18	Right	more
V2106 — Primary OIC -lesion	06	Fracture	more
V2107 — Primary OIC -system/Organ	19	Skeletal	more
V2108 — Primary OIC -severity	2	Moderate	more
V2109 — Primary OIC	QRFS2	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 324: Occupant # 1; Injury #20

Variable Number and Name	Code Value	Code Description	Other Options
V2101 — Injury Number	20	Injury #20	more
V2102 — 1st Prob Contact Area	40	Floor	more
V2103 — 2nd Prob Contact Area	00	No Contact/not applicable	more
V2104 — Primary OIC -body Region	17	Ankle/foot	more
V2105 — Primary OIC -aspect	18	Right	more
V2106 — Primary OIC -lesion	06	Fracture	more
V2107 — Primary OIC -system/Organ	19	Skeletal	more
V2108 — Primary OIC -severity	2	Moderate	more
V2109 — Primary OIC	QRFS2	—	—
V2110 — Assoc OIC 1 -body Region	99	No injury	more
V2111 — Assoc OIC 1 -aspect	99	No injury	more
V2112 — Assoc OIC 1 -lesion	99	No injury	more
V2113 — Assoc OIC 1 -system/Organ	99	No injury	more
V2114 — Assoc OIC 1 -severity	9	Unknown	more
V2115 — Assoc OIC 1	—	—	—

Case # 324: Occupant # 1

Variable Number and Name	Code Value	Code Description	Other Options
V2001 — Occupant Number	01	Occupant #1	more
V2002 — Occupant Role At 1st Impact	1	Motor vehicle driver	more
V2003 — Occupant Position -row	1	1st row	more
V2004 — Occupant Position -lateral	1	Left	more
V2005 — Occupant Position -posture	10	Sitting on seat	more
V2006 — Occupant Age In Years	20	—	—
V2007 — Occupant Age In Months	25	25 months or older	more
V2008 — Occupant Mass	060 kg	—	—
V2009 — Occupant Height	168 cm	—	—
V2010 — Occupant Sex	2	Female	more
V2011 — Occupant Treatment/Mortality	04	Hospitalized over 24 hrs or for significant treatment	more
V2012 — Injury Severity Score	22	—	—
V2013 — Non-impact Med Condition	0	None	more
V2014 — Police Injury Severity	3	A - Incapacitating Injury	more
V2015 — Active Restraint System	3	Both lap belt and shoulder harness	more
V2016 — Active Restraint Usage	3	Both lap belt and shoulder harness	more
V2017 — Passive Restraint System	1	Air bag installed	more
V2018 — Passive Restraint Usage	2	Air bag deployed	more
V2019 — Child Seat Type	88	Not applicable (adult or older child)	more
V2020 — Occupant Ejection Degree	0	None	more
V2021 — Occupant Ejection Area	98	Not applicable (not ejected)	more
V2022 — Highest OIC Severity	3	Serious	more

V2023 — Head Restraint Available	1	Equipped	more
V2024 — Occupant Eyewear	0	None	more
V2025 — Source of Occupant Info	1	Hospital	more



























































































































WARNING
DO NOT REMOVE OR
DISCARD THIS LABEL

























































